New Software version FLSTDmMCDE 4.0

Standard Modular Chiller 1/8 compressors

Bug Fixed

- Rel.= 3.9 contained wrong default values in Italian language. Now the default are aligned in all languages.
- Rel. <= 3.8 Machine type 1, with 8 compressors on 2 circuits and single coil condensation. The fans was forced to 100% when the freecoling is active and the slave circuit is on (as frecooling require without considering condensing demand). From release 3.9 if there is at least one compressor on, even in the slave circuit, the condensation fans respect the condensing regulation request.

This version needs:

- Boot 4.03 e Bios 5.02 for pCOXS,pCO3
- Boot 3.01 e Bios 3.84 for pCO2
- Italian manual, code +030221250 ver. 2.8 dated 25/02/2011
- English manual, code +030221251 ver. 2.8 dated 25/02/2011
- German manual, code +030221253 ver. 2.8 dated 25/02/2011

.